

# **PRODUCT DATA SHEET**

# PureCast Clear Epoxy Resin/PureCast T15 Slow Hardener

# EPOXY CASTING RESIN WITH HIGH TRANSPARENCY SUITABLE FOR DEEP POURING

APPLICATIONS			
	<ul> <li>For applications furniture, art and decoration to make deep pour transparent and UV resistant castings such as river table, embeddings, mock-ups, trophies</li> </ul>		
MAIN PROPERTIES			
	<ul> <li>High transparen</li> </ul>	су	
	<ul> <li>Low viscosity</li> <li>Self-degassing behaviour</li> <li>Single pour casting up to 45 mm @ 20°C</li> <li>Good UV resistance</li> </ul>		
DESCRIPTION			
Basis	Two component epoxy system		
Component A	PureCast Clear Epoxy Resin, unfilled, bluish-transparent		
Component B	PureCast T15 Slow Hardener, amine, unfilled, transparent		
PHYSICAL PROPERTIES		Resin (A)	Hardener (B)
Components		PureCast Clear Epoxy Resin	PureCast T15 Slow Hardene
Viscosity, 25 °C	mPa.s	~ 500	~ 100
Mixing ratio	in parts by weight	100	45
	in parts by volume	100	50
		Mixture	
Colour		transparent	
		· · · · · · · · · · · · · · · · · · ·	

(Max. exothermic temperature) °C ~ 35 \* refer to the graph below, influence of room temperature (RT) on exothermic reaction and curing time on 500 g casted in a

mPa.s

h




Reactivity on 500 g, 23 °C\*

Viscosity, 25 °C




~ 300 ~ 17

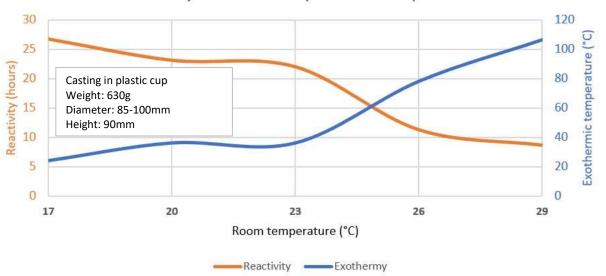

# Reactivity and exothermy vs room temperature

Reactivity vs time & temperature

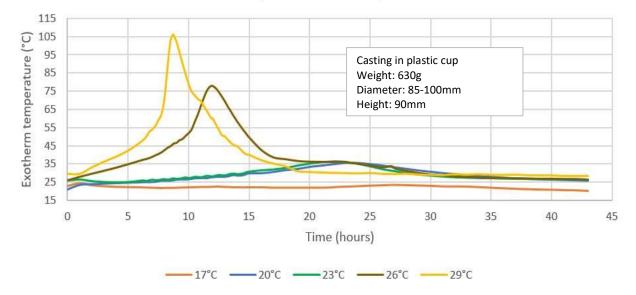



# **MECHANICAL AND THERMAL PROPERTIES**

approx. values on standard-sized specimen / after curing 7 days at room temperature

Shore hardness	ISO 868	Shore D1	D 80
Elongation at maximum strength	ISO 527	%	4,5
Flexural modulus	ISO 178	МРа	2,100
Glass transition temperature (TG)	ISO 11359-2	°C	39
Glass transition temperature (TG) after 16H at 50°C	ISO 11359-2	°C	47

## **SPECIFIC PROPERTIES**

/laximum casting thickness n plate 350 x 300 mm		Room temperature	Thickness (mm)
	Lowest temperature to work with	17 °C	80
		20 °C	45
		23 °C with fan	70
		23 °C	35-40
		26 °C	30
	Highest temperature to work with	29°C	25

### **PACKAGING UNITS**

- Resin (A), PureCast Clear Epoxy Resin
- Hardener (B), PureCast T15 Slow Hardener
- 1000 kg / 220 kg / 5 kg net 950 kg / 200 kg / 2.25 kg net

## **PROCESSING DATA**

- Room temperature is the most important parameter to be successful in
   PureCast Clear Epoxy Resin casting. There is a link in between room temperature (RT), volume of cast resin and curing speed. A speed curing caused by warm RT creates high exothermic reaction and cured resin could be yellow with streaks on top.
- Above 4kg volume and a casting height of more than 40mm it is recommended to decrease the exothermic temperature by using a fan or reducing the room temperature.
- Mixing should be done by hand or with an electric mixer. Be careful not to incorporate too much air while mixing. Emulsion must be avoided.
- After a primary mixing in a bucket pour the product in a second bucked and finish the mixing. Scrap well the walls of the mixing container. Leave the mixing for a selfdegassing for at least 15 to 30 minutes prior to cast or use a vacuum chamber.
- According to long pot life and low viscosity the casting frame must be perfectly tight. Brown PE packing tape is self-releasing from the resin and could be used in corners of the box and anywhere resin should not bond on support.
- A liquid or pasty wax could be also used to prevent bonding on models and supports. The wood or porous surfaces of models must be sealed before casting the resin. Quick setting epoxy or a varnish could be used but sealer must be cured prior to casting of **PureCast Clear Epoxy Resin**.
- After casting and some relaxation time the remaining bubbles can easily be removed with a hot airstream gun (sweep the surface at 15 – 20 cm of distance).
- A thin sanding and polishing are almost always needed to get shiny and flat surface. Use appropriate tools in order to avoid heat on the resin when polishing. Water sandpaper is advised.
- Prolonged intensive UV exposure can lead to optical changes or changes in transparency.



# **STORAGE CONDITIONS**

Shelf life	<ul> <li>Resin (A), PureCast Clear Epoxy Resin</li> <li>Hardener (B), PureCast T15 Slow Hardener</li> </ul>	12 months 12 months	
Storage temperature	<ul> <li>Resin (A), PureCast Clear Epoxy Resin</li> <li>Hardener (B), PureCast T15 Slow Hardener</li> </ul>	15 – 25 °C 15 – 25 °C	
Crystallization	<ul> <li>After prolonged storage at low temperature, crystallization of A (RESIN) component may occur.</li> <li>This is easily removed by warming up for a sufficient time to a maximum of 70 °C.</li> <li>Allow to cool to requested processing temperature before use.</li> </ul>		
Opened packagings	ingress.	<ul> <li>Containers must be closed tightly immediately after use to prevent moisture ingress.</li> <li>The residual material needs to be used up as soon as possible.</li> </ul>	

### FURTHER INFORMATION

The information herein is offered for general guidance only. Advice on specific applications is available on request from the Technical Department of CFSNET Ltd. Copies of the following publications are available on request: Safety Data Sheets

#### BASIS OF PRODUCT DATA

All technical data stated in this document are based on laboratory tests. Actual measured data may vary due to circumstances beyond our control.

#### HEALTH AND SAFETY INFORMATION

For information and advice regarding transportation, handling, storage and disposal of chemical products, users shall refer to the actual Safety Data Sheets containing physical, ecological, toxicological and other safety-related data.

#### LEGAL NOTICE

The information, and, in particular, the recommendations relating to the application and enduse of CFSNET Ltd products, are given in good faith based on CFSNET Ltd's current knowledge and experience of the products when properly stored, handled and applied under normal conditions in accordance with CFSNET Ltd's recommendations. In practice, the differences in materials, substrates and actual site conditions are such that no warranty in respect of merchantability or of fitness for a particular purpose, nor any liability arising out of any legal relationship whatsoever, can be inferred either from this information, or from any written recommendations, or from any other advice offered. The user of the product must test the product's suitability for the intended application and purpose. CFSNET Ltd reserves the right to change the properties of its products. The proprietary rights of third parties must be observed. All orders are accepted subject to our current terms of sale and delivery. Users must always refer to the most recent issue of the local Product Data Sheet for the product concerned, copies of which will be supplied on request.



## Contact

CFSNET Ltd United Downs Industrial Park St Day Redruth Cornwall TR16 5HY

Tel: +44 (0)1209 821028 Fax: +44 (0)1209 822192 Email: sales@cfsnet.co.uk www.cfsnet.co.uk

